

Accessori di fissaggio per cilindro tondo con magnete

Serie AS, CBF, P, DM



AS



CBF



P



GM

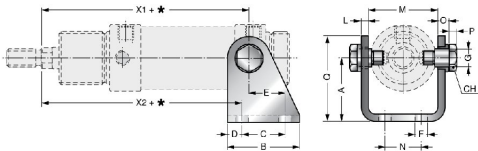
Materiale

Acciaio

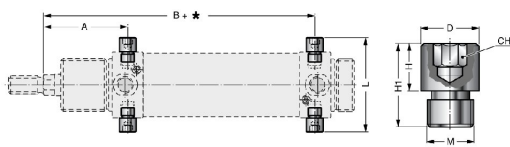
Nota

adatto a cilindro tondo con magnete permanente Serie ACMT, DVMT

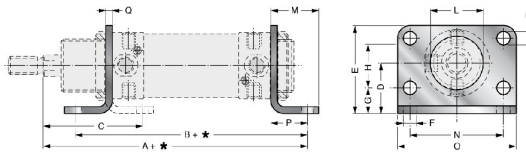
AS / .. Fissaggio orientabile

 * = Corsa	Ø	X1	X2	A	B	C	CH	D	E	ØF	ØG	L	M	N	O	P	Q	Tipo
	32	125	121	35	40	24	13	8	20	7	10	4	38,1	20	6	4	47	AS/32
	40	146	143	40	50	30	17	10	27	9	12	5	46,1	28	7	5	53	AS/40
	50	158	154	45	54	34	19	10	30	9	14	6	57,1	36	8,5	6	59	AS/50

CBF / .. Perno oscillante

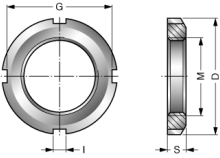
 * = Corsa	Ø	A	B	CH	ØD	H	H1	L	M	Tipo
	32	47	125	5	10	8	14	51	M8x1	CBF/32
	40	57	146	6	12	9,5	16,5	61	M10x1	CBF/40
	50	62	158	6	14	11	20	75	M12x1,5	CBF/50

P / .. Fissaggio a piede

 * = Corsa	Ø	A	B	C	D	E	F	G	H	L	M	N	O	P	Q	Tipo
	32	148	124	48	28	49	7	14	28	30	21	52	66	14	4	P/32
	40	178	153	60	33	58	9	18	30	38	30	60	80	20	5	P/40
	50	190	160	64	40	70	9	20	40	45	30	70	90	20	6	P/50-S



DM / .. Dado di fissaggio per collo morsetto

	Ø	ØD	G	I	M	S	Tipo
	32	45	40	5	M30x1,5	7	GM/32
	40	50	46	5	M38x1,5	8	GM/40
	50	58	52	6	M45x1,5	9	GM/50

Illustrazioni non vincolanti
Con riserva di modifiche costruttive, dimensionali e dei materiali

Pneumatica / Elementi di lavoro / Cilindro tondo con accessori / Fissaggio a piede Serie P

